

Delta 1200/115 Accumulator Tray Kit - 06401-031-66-21



Disconnect electrical power at the breaker or disconnect switch and tag-out in accordance with procedures and codes.

KIT CONTENTS

- 1 Scrap Tray
- 1 Strainer
- 1 Hose
- 1 Clamp
- 2 Bushings

TOOLS REQUIRED

- Flathead Screwdriver

1. Disconnect electrical power supplies and tag-out in accordance with procedures and codes. Shut-off incoming water and drain machine.
2. Place the scrap tray with strainer on the front of machine.



3. Connect the hose to scrap tray using the clamp from the kit and a flathead screwdriver.



4. Remove plug and put one of the bushings from the kit in the hole on the front-left of machine.




ACCUMULATOR TRAY INSTALL

5. Push loose end of the hose through the bushing and push until there is no slack between the scrap tray and front of machine.



6. At back of machine, locate loose end of the hose and pull until there is no slack. Ensure the hose is located under the lip on the side of the tank.

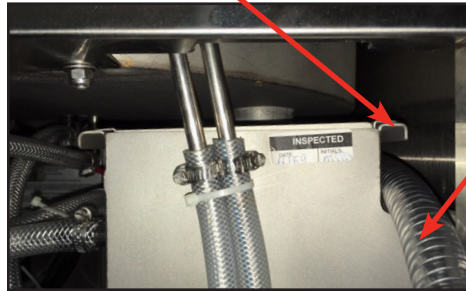

7. Put the other bushing from the kit in the hole on the bottom-right of the tank.



8. Push loose end of the hose through the bushing and push until there is no slack left in the hose (hose can be trimmed, if necessary).



9. Restore water and power to machine.